



LU Volkswagen Polo: EM5974

Vinnnumber:	WVWZZZ6RZGY084843	Versionname:	1.4 TDI 66KW COMFORTLINE BMT
First Registrationdate:	22/10/2015	Fiscalpower:	
Expertise Mileage:	120398	Power Kw:	66
Bodytype:		Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2827
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

185/60/15/84 H Steel				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Hankook: 4 mm	Re.R.	Hankook: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	464,00
Rear window, Scratch(es), Acceptable	0,00

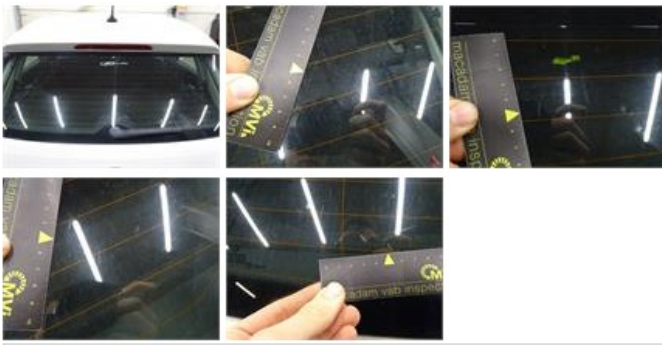

Backrest cover F L, Worn, Acceptable 0,00



Wheel cover R R, Missing, E - Replace 24,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 246,56



Bodywork, Glue residues, Acceptable 0,00



Wheel cover F R, Scratch(es), E - Replace 24,00



Bumper moulding F M, Scratch(es), Acceptable 0,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 169,44



Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Stone chip(s), Acceptable	0,00
<i>No pictures to display</i>	