



VOLVO V60: 1LVV603

Vinnumber:	YV1FW74C1G1309676	Versionname:	2.0 D2 VOLVO OCEAN RACE
First Registrationdate:	26/11/2015	Fiscalpower:	
Expertise Mileage:	108422	Power Kw:	88
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2329
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Sport seats			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/40/18/95 W LightMetal				
Winter tyres:	Fr.L.	Michelin: 7 mm	Fr.R.	Michelin: 7 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment






Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------


Total cost ex VAT		723,80
-------------------	--	--------

Wing R L, Dent(s), Acceptable		0,00
-------------------------------	--	------

<i>No pictures to display</i>		
Seat cover F L, Scratch(es), Acceptable		0,00
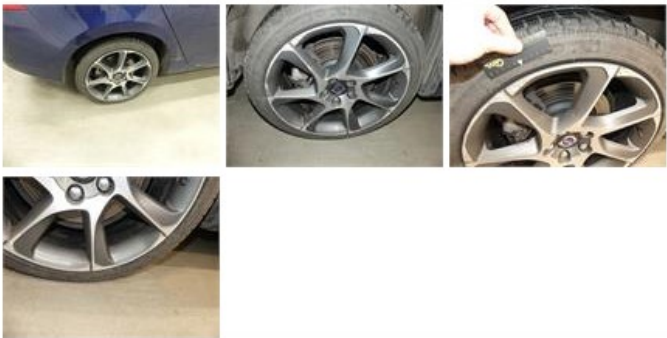
<i>No pictures to display</i>		
-------------------------------	--	--

Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00
	
Wing R R, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)	95,00
	
Rocker panel inner R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00
	
Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	211,80
	
Tyre F L, Tear, E - Replace	132,00
	
Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)	95,00

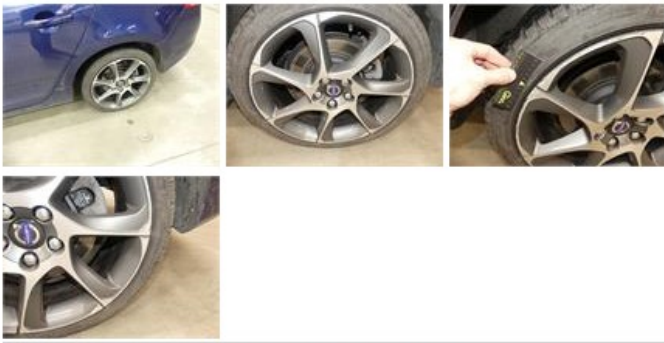

Bumper F, Dent(s) and scratch(es), Le - Replace and paint

0,00

