



VOLKSWAGEN Crafter 50 LWB hoog dak: 1FWL340

Vinnumber:	WV1ZZZ2ZE6010659	Versionname:	CRAFTER 50A B/F2C LWB HR 136PK Gedat.3,5
First Registrationdate:	19/11/2013	Fiscalpower:	
Expertise Mileage:	238097	Power Kw:	100
Bodytype:		Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	LCV30
Battery functioning:	No		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar fixed
Type of headlighting	Headlighting Halogen		
Type of Lining	Lining artificial leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	No
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/16/92 H Steel			
Summer tyres:	Fr.L. Uniroyal: 5 mm	Fr.R. Uniroyal: 5 mm	
	Re.L. Uniroyal: 6 mm	Re.R. Uniroyal: 6 mm	

Assistance equipment

Spare wheel	No	Jack	Yes
Total cost ex VAT			2817,45
Door R R, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Internal Boot Lining L, Broken, E - Replace			15,00



Trunk door R L, Dent(s) and scratch(es), Le - Replace and paint



Door seal F L, Deformed / Strained, E - Replace

46,50



Internal Boot Lining R, Broken, E - Replace

15,00



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Wing trim R R, Scratch(es), E - Replace

69,00



Door R L, Dent(s), LI - Repair and paint (complete)

238,76



Trunk door R R, Dent(s), LI - Repair and paint (complete)

322,00



Sidewall RR (LCV), Scratch(es), Acceptable

0,00

No pictures to display

Roof, Dent(s), LI - Repair and paint (complete)

409,13



Bumper trim R, Hole, E - Replace

101,25




Wing F R, Dent(s) and scratch(es), Le - Replace and paint

427,51



Brand badge R, Incomplete, E - Replace

36,26

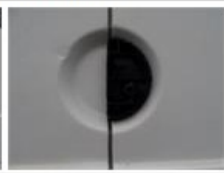

Bumper R, Scratch(es), Smart repair

110,64

