



**VOLKSWAGEN Passat: 1GAL961**

Vinnumber:	<b>WVWZZZ3CZEE081262</b>	Versionname:	<b>PASSAT VAR Comfortline 136PK</b>
First Registrationdate:	<b>6/12/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>147272</b>	Power Kw:	<b>100</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3602</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Sun Roof electric	
GPS storage		Panoramic roof	
GPS storage	<b>HD</b>	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	<b>No Tow bar</b>
Seats F heated			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>215/55/16/93 H LightMetal</b>				
Winter tyres:	Fr.L.	<b>Goodyear: 5 mm</b>	Fr.R.	<b>Goodyear: 5 mm</b>
	Re.L.	<b>Semperit: 7 mm</b>	Re.R.	<b>Semperit: 7 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT 1752,94

Door F R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Roof, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

301,68



Bonnet, Stone chip(s), Acceptable

0,00

No pictures to display


Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

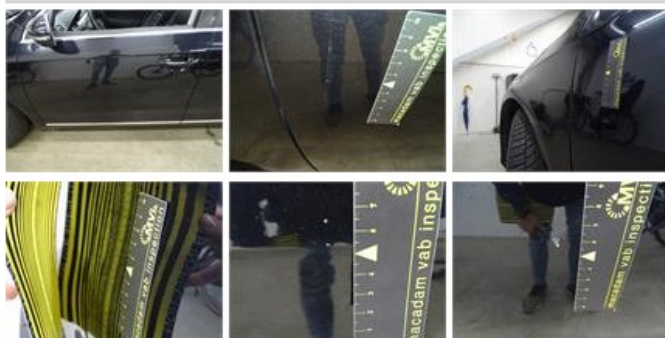

Wing F R, Dent(s) and scratch(es), Acceptable

0,00




Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





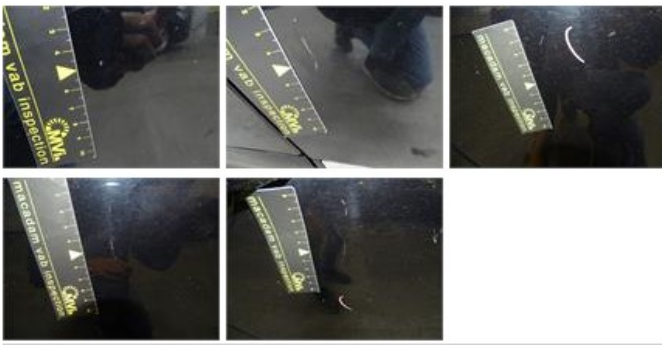

Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Backrest cover F L, Worn, Acceptable 0,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Rear spoiler, Dent(s) and scratch(es), LI - Repair and paint (complete) 115,56



Windscreen, Broken, E - Replace 487,20



Wing F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display