


AUDI A3: 1HYP155

Vinnumber:	WAUZZZ8V9FA060408	Versionname:	A3 SB Ultra Attraction 110PK
First Registrationdate:	30/10/2014	Fiscalpower:	
Expertise Mileage:	123995	Power Kw:	81
Bodytype:		Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metallic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3409
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	SD Rear parking sensors
Windows electric F	Type of Tow bar
Windows electric R	No Tow bar
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 3 mm	Fr.R.	Bridgestone: 3 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1660,08
Moulding windscreen L, Scratch(es), E - Replace			24,60



Ignition key, Missing, E - Replace	150,00
------------------------------------	--------



Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wing R L, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Interior, Stain, Cleaning	30,00
---------------------------	-------



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Roof, Hail damage, PDR - Hail	150,00
-------------------------------	--------



Bodywork, Damaged, P - Check	0,00
------------------------------	------





Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Door R L, Scratch(es), Acceptable

0,00

No pictures to display


Rocker panel inner R R, Scratch(es), Acceptable

0,00

No pictures to display

Sill outer R, Scratch(es), LI - Repair and paint (complete)

310,50

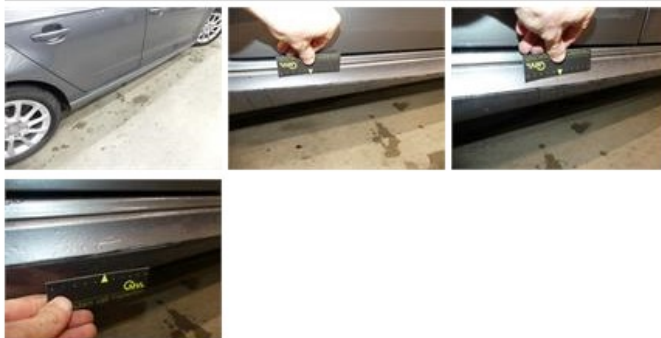

Rear window, Scratch(es), E - Replace

370,00



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical polution, Acceptable

0,00

No pictures to display

Boot cover, Broken, E - Replace

50,00



Door R R, Dent(s), Acceptable

0,00

No pictures to display

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

268,18

