



BMW 3 GRAN TURISMO: 1LVH683

Vinnumber:	WBA8Y51090G430640	Versionname:	2.0 318D (100KW) GRAN TURISMO
First Registrationdate:	16/12/2015	Fiscalpower:	
Expertise Mileage:	162184	Power Kw:	100
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance	OK		
Maintenance	24000KM		
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/97 H LightMetal				
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------


Total cost ex VAT	1322,68
-------------------	----------------

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

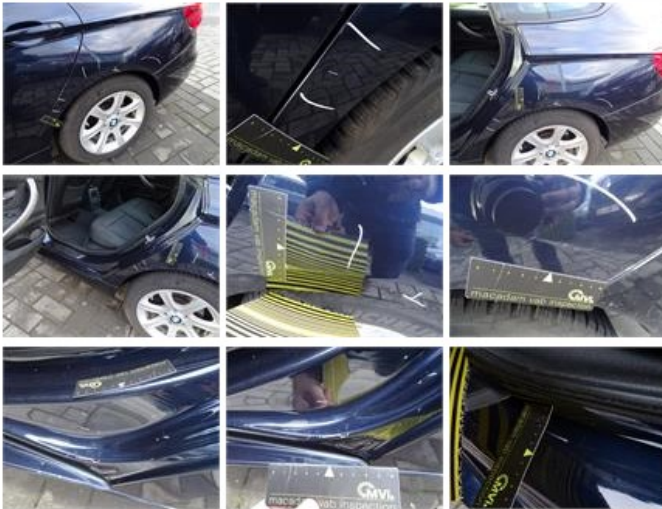

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Outer backrest protection L, Scratch(es), Smart repair

110,64



Door R L, Scratch(es), Acceptable

0,00



Seat cover R, Stain, Cleaning

50,00



Seat cover F L, Stain, Cleaning

25,00



Seat cover F R, Stain, Cleaning

25,00



Wing R R, Dent(s), LI - Repair and paint (complete)

308,20



Outer backrest protection R, Scratch(es), Smart repair

110,64



Door F L, Scratch(es), Acceptable

0,00



Wing F L, Scratch(es), Acceptable

0,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing F R, Scratch(es), Acceptable

0,00



Boot carpet, Damaged, E - Replace

100,00



Bonnet, Stone chip(s), Acceptable

0,00



Door F R, Scratch(es), Acceptable

0,00

