



VOLKSWAGEN PASSAT VARIANT: 1LSJ385

Vinnumber:	WVWZZZ3CZGE120977	Versionname:	2.0 TDI VARIANT HIGHLINE
First Registrationdate:	23/11/2015	Fiscalpower:	
Expertise Mileage:	134164	Power Kw:	110
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2416
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather and alcantara
Type of climate control	Autom climate control
Adaptive cruise control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/17/94 V LightMetal				
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Uniroyal: 3 mm	Re.R.	Uniroyal: 3 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1662,28
-------------------	----------------

Bumper moulding F R, Broken, E - Replace	14,40
--	--------------



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s), PDR - Paintless dent repair 63,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Dent(s), PDR - Paintless dent repair 63,00



Bumper F, Deformed / Strained, Le - Replace and paint 735,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s), Acceptable 0,00

No pictures to display


Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Seat cover F L, Burned, Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

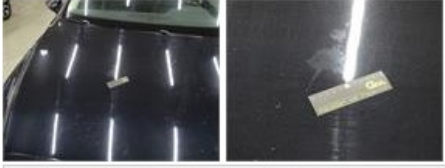

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00

