



**BMW 4 GRAN COUPE: 1LTV434**

Vinnumber:	<b>WBA4E71000G518706</b>	Versionname:	<b>2.0 418D (100KW) GRAN COUPE</b>
First Registrationdate:	<b>3/12/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>139569</b>	Power Kw:	<b>100</b>
Bodytype:		Body color:	<b>Dark Brown</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1733</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Xenon</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining artificial leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>NOT OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/60/16/99 V LightMetal</b>			
Summer tyres:	Fr.L.	<b>Goodyear: 2 mm</b>	Fr.R.	<b>Goodyear: 2 mm</b>
	Re.L.	<b>Goodyear: 4 mm</b>	Re.R.	<b>Goodyear: 4 mm</b>

**Assistance equipment**

Number of charging cables (normal)	<b>0</b>
Number of charging cables (rapid charge)	<b>0</b>

Total cost ex VAT	<b>2223,36</b>
Door R R, Chemical polution, Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Door R L, Scratch(es), LI - Repair and paint (complete)	<b>382,02</b>



Bumper grille, Broken, E - Replace

34,08



Door F L, Scratch(es), LI - Repair and paint (complete)

382,02



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16

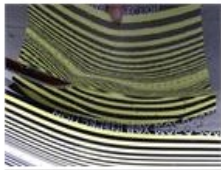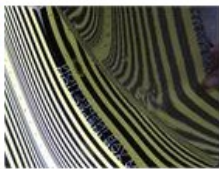

Wing R R, Scratch(es), It - Spot repair

115,56



Sill outer L, Scratch(es), It - Spot repair

115,56



Headlight sprinkler cover R, Missing, E - Replace

108,00



Alloy rim F R, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete)

577,80



Bumper F, Dent(s), LI - Repair and paint (complete)

254,16

