



**VOLVO V40: 1LHD392**

Vinnumber:	<b>VV1MV7431G2301461</b>	Versionname:	<b>2.0 D2-82 MOMENTUM</b>
First Registrationdate:	<b>28/09/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>89311</b>	Power Kw:	<b>88</b>
Bodytype:		Body color:	<b>Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance	<b>PLUS 7101 KM</b>	Parking lot:	<b>1506</b>
Maintenance	<b>OK</b>		
Battery functioning	<b>Yes</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	<b>Tow bar removable</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining semi-leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/55/16/91 H LightMetal</b>				
Winter tyres:	Fr.L.	<b>Goodyear: 7 mm</b>	Fr.R.	<b>Goodyear: 7 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	<b>354,80</b>
-------------------	---------------

Bumper F, Repaired, Acceptable	<b>0,00</b>
--------------------------------	-------------



Rearview mirror housing R, Scratch(es), Acceptable

0,00



Windscreen, Bad repair, E - Replace

0,00



Wing R R, Dent(s) and scratch(es), Acceptable

0,00



Maintenance, Maintenance, P - Check

0,00



Door panel R R, Scratch(es), Acceptable

0,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

259,80



Wing F L, Scratch(es), Acceptable

0,00




Spoiler R, Scratch(es), Acceptable

0,00



Wing R L, Bad repair, LI - Repair and paint (complete)

0,00

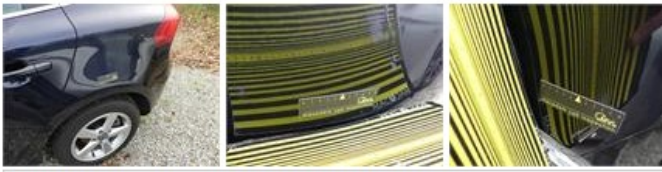

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00

