


**AUDI A6: 1HXA835**

Vinnumber:	<b>WAUZZZ4G6EN200512</b>	Versionname:	<b>A6 AVANT 163PK</b>
First Registrationdate:	<b>17/10/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>108621</b>	Power Kw:	<b>120</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metallic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>3205</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Type of headlighting	<b>Headlighting LED</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>225/60/16/92 MS LightMetal</b>			
Winter tyres:	Fr.L.	<b>Continental: 4 mm</b>	Fr.R.	<b>Continental: 4 mm</b>
	Re.L.	<b>Continental: 5 mm</b>	Re.R.	<b>Continental: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Total cost ex VAT			<b>1818,83</b>
Alloy rim R L, Scratch(es), Acceptable			<b>0,00</b>
<i>No pictures to display</i>			
Alloy rim F R, Scratch(es), Acceptable			<b>0,00</b>
<i>No pictures to display</i>			
Rocker panel inner R L, Scratch(es), Forfeit			<b>115,56</b>



Bumper F, Scratch(es), LI - Repair and paint (complete)

254,16



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Windscreen, Stone chip(s), Windscreen repair

0,00



Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)

348,09




Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16



Rear window, Scratch(es), E - Replace

0,00

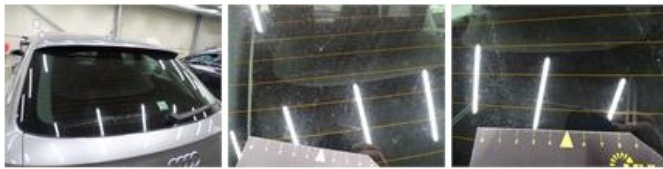

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

369,84



Backrest cover F L, Worn, Acceptable

0,00

