



BMW 4 GRAN COUPE: 1LLB127

Vinnumber:	WBA4E91050G288012	Versionname:	2.0 420D (120KW) GRAN COUPE
First Registrationdate:	16/10/2015	Fiscalpower:	
Expertise Mileage:	178980	Power Kw:	120
Bodytype:		Body color:	Blue
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4208
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	NOT OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/94 H LightMetal				
Winter tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2572,18
--------------------------	----------------

Wing R R, Dent(s), Acceptable	0,00
--------------------------------------	-------------

No pictures to display

Sill outer R, Scratch(es), LI - Repair and paint (complete)	372,60
--	---------------



Door R L, Dent(s), Acceptable 0,00

No pictures to display

Door F L, Dent(s), LI - Repair and paint (complete) 382,02




Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Dent(s), Acceptable 0,00

No pictures to display

Door R R, Dent(s), LI - Repair and paint (complete) 382,02

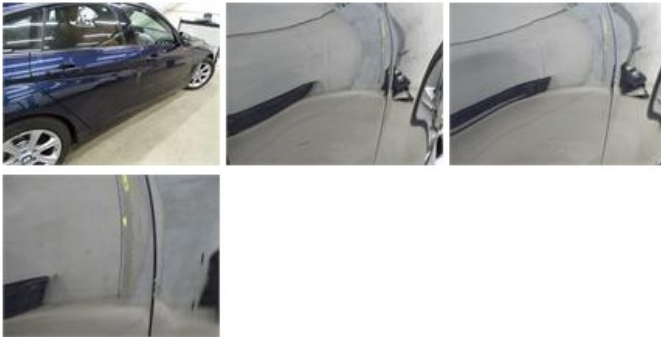

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Reflector, Broken, E - Replace 104,20



Tailgate, Dent(s), Acceptable 0,00


No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16





Roof, Hail damage, PDR - Hail 0,00

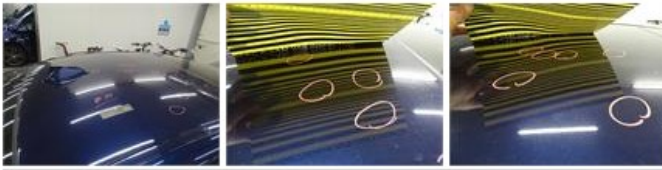

Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16



Door F R, Dent(s), LI - Repair and paint (complete) 382,02



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Dent(s), Acceptable 0,00

No pictures to display

Foglight L, Crack, E - Replace 156,00

