



FORD GRAND C-MAX: 1KVN456

Vinnumber:	WF0HXXGCBHFD84876	Versionname:	1.6 TDCI 85KW S/S TREND STYLE
First Registrationdate:	14/07/2015	Fiscalpower:	
Expertise Mileage:	167018	Power Kw:	85
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2808
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar fixed
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/16/97 W LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	No	Compressor	No
		Jack	Yes

Total cost ex VAT 2214,60

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), 67 - Polish

50,00



Bonnet, Scratch(es), LI - Repair and paint (complete)

290,08



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (partial)

332,20



Door F L, Dent(s), PDR - Paintless dent repair

63,00



Seat cover R, Stain, Cleaning

50,00



Interior, Dirty, Cleaning

100,00



Wing F R, Scratch(es), 67 - Polish

25,00



Seat cover F R, Stain, Cleaning

25,00



Seat cover F L, Stain, Cleaning

25,00



Door F R, Scratch(es), 67 - Polish

0,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bodywork, Dirty, P - Check

0,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Tyre repair kit, Missing, E - Replace 210,53



Ceiling, Dirty, Cleaning 75,00




Roof, Dent(s), PDR - Paintless dent repair 63,00



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Trunk lid covering R, Scratch(es), Smart repair 110,64

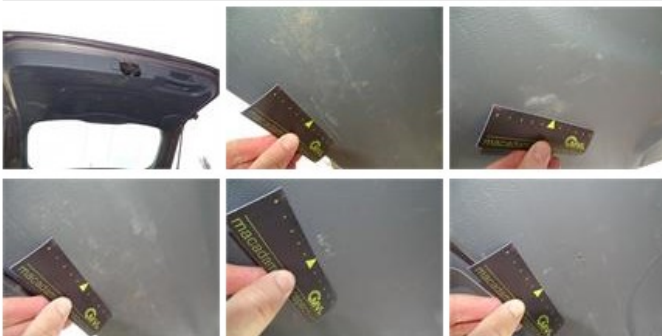

Roofrack, Scratch(es), Forfeit 75,00

