


**OPEL ASTRA: 1LNT141**

Vinnumber:	<b>W0LBD6EK1G8016633</b>	Versionname:	<b>1.6 CDTI 81KW ECOFLEX S/S EDITION</b>
First Registrationdate:	<b>30/10/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>137083</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1233</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunctional	Rear parking sensors
Radio multimedia	Type of Tow bar
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Manual climate control</b>
	<b>No Tow bar</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

Winter tyres:	<b>205/55/16/91 H Steel</b>			
	Fr.L.	<b>Uniroyal: 5 mm</b>	Fr.R.	<b>Uniroyal: 5 mm</b>
	Re.L.	<b>Uniroyal: 5 mm</b>	Re.R.	<b>Uniroyal: 5 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	<b>411,35</b>
Bumper F, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Door F R, Dent(s), LI - Repair and paint (complete)	<b>318,35</b>

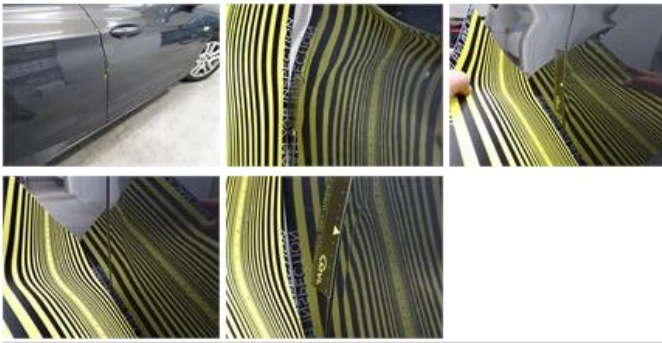

Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Dent(s), PDR - Paintless dent repair	63,00



Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wheel cover F R, Scratch(es), E - Replace	30,00

