



VOLKSWAGEN PASSAT VARIANT: 1LDH589

Vinnumber:	WVWZZZ3CZGE035084	Versionname:	2.0 TDI VARIANT COMFORTLINE
First Registrationdate:	27/08/2015	Fiscalpower:	
Expertise Mileage:	147615	Power Kw:	110
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1504
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats F L ventilated
GPS storage		Seats F R ventilated
GPS storage	HD	Sun Roof electric
Windows electric F		Panoramic roof
Windows electric R		Central consol F
Cruise Control		Luggage cover
Steering wheel multifunctional		Front parking sensors
Seats F heated		Rear parking sensors
Radio multimedia		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/45/18/96 V LightMetal				
Winter tyres:	Fr.L.	Vredestein: 4 mm	Fr.R.	Vredestein: 4 mm
	Re.L.	Vredestein: 5 mm	Re.R.	Vredestein: 5 mm

Assistance equipment


Spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2485,43
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00



Bonnet, Dent(s), LI - Repair and paint (complete)

290,08

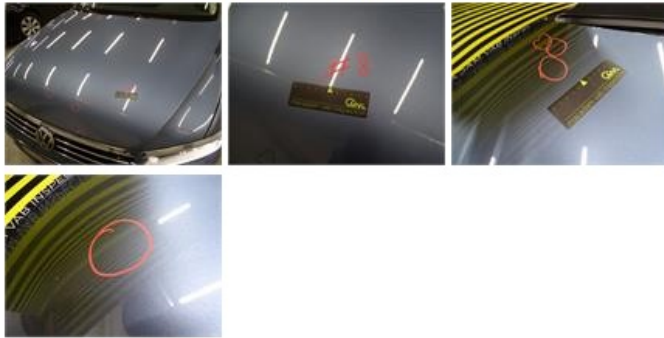

Wing R L, Dent(s), PDR - Paintless dent repair

63,00




Windscreen, Stone chip(s), E - Replace

487,20



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00

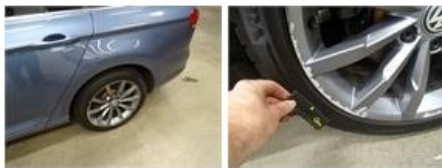

Bumper F, Dent(s), Le - Replace and paint

735,00



Wing R L, Dent(s), Acceptable

0,00

No pictures to display


Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

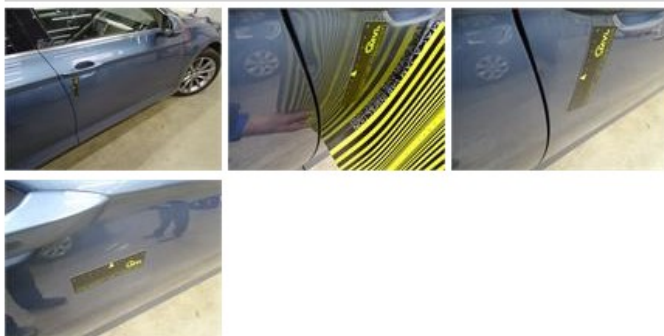

Door R L, Dent(s), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00

