



BMW 1 HATCH: 1KNH341

Vinnumber:	WBA1V910605B16007	Versionname:	1.5 116D EFFICIENTDYNAMICS EDIT. (85KW)
First Registrationdate:	2/06/2015	Fiscalpower:	
Expertise Mileage:	103487	Power Kw:	85
Bodytype:	Hatchback	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OVER 20000 KM	Parking lot:	3709
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 H LightMetal				
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 1158,90

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18




Door R R, Scratch(es), 67 - Polish 50,00

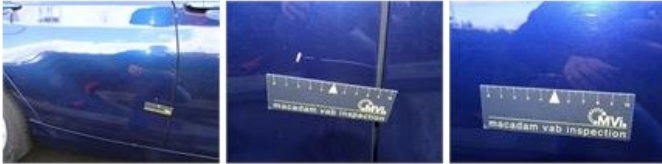

Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08



Rearview mirror basis L, Scratch(es), Smart repair 110,64

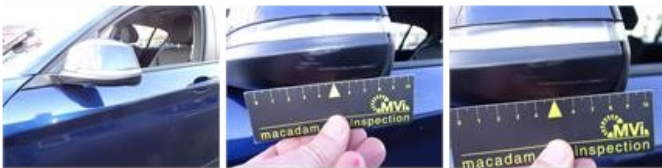

Alloy rim F L, Scratch(es), Acceptable 0,00



Trunk lid covering R, Scratch(es), Smart repair 110,64



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Seat cover F L, Worn, P - Check 0,00




Alloy rim R R, Scratch(es), Acceptable

0,00



Bumper R, Scratch(es), 67 - Polish

50,00

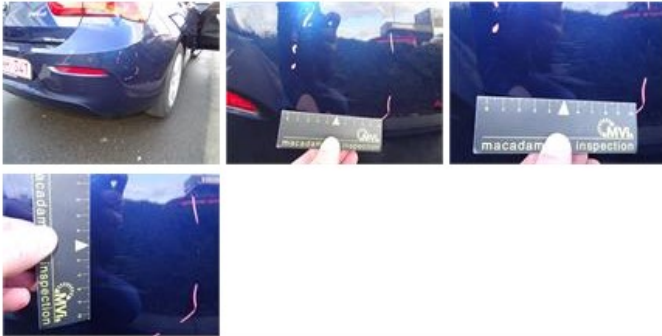

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56

