



BMW 5 BERLINE: 1RNS648

Vinnumber:	WBA5E31080G738141	Versionname:	2.0 518D (110KW)
First Registrationdate:	31/01/2017	Fiscalpower:	
Expertise Mileage:	84002	Power Kw:	110
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3124
Maintenance:	SERVICE IN 700KM 3 2021		
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage		Seats electric F R	
GPS storage	HD	Sun Roof electric	
Windows electric F		Panoramic roof	
Windows electric R		Central consol F	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Adaptive cruise control			

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/97 H LightMetal				
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			2301,05
Bumper F, Scratch(es), LI - Repair and paint (complete)			254,16

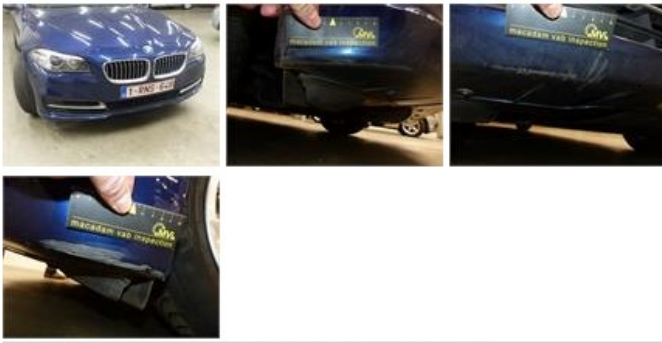

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Side window trim F L, Dent(s), E - Replace 62,00



Interior, Dirty, Cleaning 150,00



Seat cover F L, Worn, Acceptable 0,00

No pictures to display

Wing R L, Chemical polution, LI - Repair and paint (complete) 369,84



Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 348,09



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Backrest cover F L, Worn, Acceptable 0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete) 577,80

