


CITROEN C3: 1HVS888

Vinnumber:	VF75C8HR4EW651989	Versionname:	C3 BER Business (Fleet) 68PK
First Registrationdate:	15/10/2014	Fiscalpower:	
Expertise Mileage:	129179	Power Kw:	50
Bodytype:		Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2204
Maintenance:	SERVICE IN 12300KM		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
Windows electric F		Luggage cover
Cruise Control		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	185/65/15/88 T Steel			
Summer tyres:	Fr.L.	Continental: 6 mm	Fr.R.	Continental: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1300,00
Door F R, Scratch(es), Acceptable	0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	246,56
---	--------



Wheel cover R R, Scratch(es), E - Replace

24,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

169,44



Roof, Scratch(es), Acceptable

0,00

No pictures to display

Roof pillar R, Scratch(es), Acceptable

0,00

No pictures to display

Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace

24,00




Wheel cover R L, Scratch(es), E - Replace

24,00



Door F L, Scratch(es), LI - Repair and paint (complete)

254,68

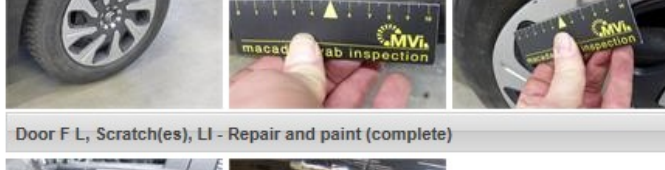

Rearview mirror R complete, Scratch(es), E - Replace

144,00



Rearview mirror housing L, Scratch(es), Acceptable

0,00

No pictures to display

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

302,68



Dashboard, Scratch(es), Smart repair

110,64

