



**MERCEDES C BERLINE: 1JRA907**

Vinnumber:	<b>WDD2050371F158767</b>	Versionname:	<b>1.6 C 200 BLUETEC AVANTGARDE</b>
First Registrationdate:	<b>4/02/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>184757</b>	Power Kw:	<b>100</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>SERV A IN 220 DAGEN</b>	Parking lot:	<b>4515</b>
Maintenance:	<b>OK</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Front parking sensors	
GPS storage	<b>SD</b>	Rear parking sensors	
Windows electric F		Type of Tow bar	<b>No Tow bar</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	<b>Headlighting LED</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/60/16/92 H LightMetal</b>				
Winter tyres:	Fr.L.	<b>Continental: 5 mm</b>	Fr.R.	<b>Continental: 5 mm</b>
	Re.L.	<b>Goodyear: 5 mm</b>	Re.R.	<b>Goodyear: 5 mm</b>

**Assistance equipment**

Repair kit	<b>No</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT 2023,69

Door frame F L, Scratch(es), Acceptable 0,00

No pictures to display

Door frame R L, Dent(s), Acceptable 0,00

No pictures to display

Backrest cover F R, Deformed / Strained, P - Check 0,00



Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Backrest cover F L, Tear, E - Replace 360,00



Bonnet, Chemical pollution, Acceptable 0,00

No pictures to display


Wing F R, Scratch(es), LI - Repair and paint (complete) 0,00



Dashboard, Glue residues, Acceptable 0,00

No pictures to display

Roof, Scratch(es), LI - Repair and paint (complete) 481,50

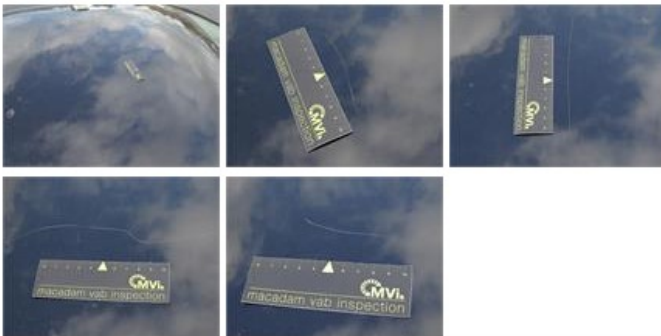

Interior, Dirty, Cleaning 25,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Tyre repair kit, Missing, Repair/replace (lump sum) 45,00



Seat cover F L, Tear, E - Replace

360,00



Door F R, Scratch(es), LI - Repair and paint (complete)

318,35



Sunblind L, Deformed / Strained, Repair/replace (lump sum)

15,00



Roof pillar R, Scratch(es), Acceptable

0,00

*No pictures to display*

Door frame R R, Scratch(es), Acceptable

0,00

*No pictures to display*

Backrest cover F L, Strained, P - Check

0,00



Door panel R L, Scratch(es), Smart repair

110,64



Centre console, Scratch(es), Acceptable

0,00

*No pictures to display*