


**RENAULT GRAND SCENIC: 1LGF265**

Vinnumber:	<b>VF1JZ89AH53724753</b>	Versionname:	<b>1.5 ENERGY DCI 110 LIFE 5P</b>
First Registrationdate:	<b>21/09/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>103125</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3611</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F
GPS storage	<b>SD</b>	Luggage cover
GPS storage		Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/60/16/96 H Steel</b>			
Winter tyres:	Fr.L.	<b>Kleber: 4 mm</b>	Fr.R.	<b>Kleber: 4 mm</b>
	Re.L.	<b>Uniroyal: 4 mm</b>	Re.R.	<b>Uniroyal: 4 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	<b>1890,74</b>
Rear window, Scratch(es), E - Replace	<b>370,00</b>




Glove box cover, Scratch(es), E - Replace

288,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80

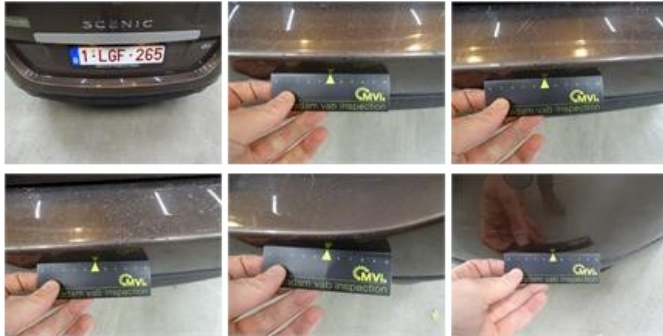

Grill frame, Broken, E - Replace

134,20



Trunk lid covering R, Scratch(es), Smart repair

110,64



Door F L, Scratch(es), Acceptable

0,00

*No pictures to display*

Bonnet, Scratch(es), Acceptable

0,00

*No pictures to display*

Door R R, Dent(s), PDR - Paintless dent repair

82,80



Door F L, Dent(s), Acceptable

0,00

*No pictures to display*

Door F R, Dent(s), Acceptable

0,00

*No pictures to display*

Door R R, Scratch(es), Acceptable

0,00

*No pictures to display*

Wheel cover F R, Scratch(es), Acceptable

0,00

*No pictures to display*

Roof, Chemical polution, LI - Repair and paint (complete)

481,50



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



*No pictures to display*