



VOLKSWAGEN Passat: 1HAB059

Vinnumber:	WVWZZZ3CZEE173365	Versionname:	PASSAT VAR Comfortline BMT 105PK
First Registrationdate:	2/06/2014	Fiscalpower:	
Expertise Mileage:	174037	Power Kw:	77
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	1727
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/55/16/92 MS LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Total cost ex VAT			1490,79
Windscreen, Scratch(es), E - Replace			0,00

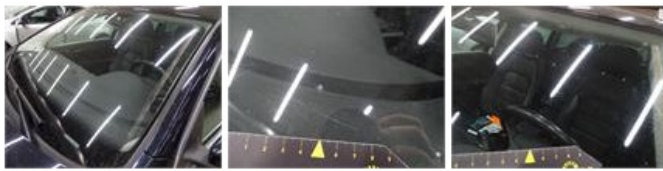

Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Window F R door, Scratch(es), E - Replace

0,00



Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20



Rear window, Scratch(es), E - Replace

0,00



Window F L door, Scratch(es), E - Replace

0,00



Door R L, Scratch(es), LI - Repair and paint (complete)

318,35



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F L, Deformed / Strained, E - Replace

235,20



Wing R R, Dent(s), Acceptable

0,00

No pictures to display

Alloy rim R R, Scratch(es), Acceptable

0,00

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68



Window R R door, Scratch(es), E - Replace

0,00



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Window R L door, Scratch(es), E - Replace 0,00



Bumper F L, Scratch(es), It - Spot repair 115,56

