



TOYOTA C-HR: SY7916

Vinnumber:	NMTKZ3BX40R006311	Versionname:	1.8 VVT I-HYBRID C-ULT AUTO
First Registrationdate:	19/01/2017	Fiscalpower:	
Expertise Mileage:	66730	Power Kw:	90
Bodytype:		Body color:	Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Hybrid Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1228
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	No		

Options

GPS storage		Central consol F
GPS storage	HD	Luggage cover
Windows electric F		Front parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting LED	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	NOT OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/50/18/99 H LightMetal			
Winter tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1560,08
Rearview mirror housing L, Bad repair, Acceptable	0,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F R polished, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), Acceptable 0,00

No pictures to display

Bumper F, Dent(s), Smart repair 110,64



Rearview mirror L complete, Broken, E - Replace 168,00



Ignition key, Missing, E - Replace 150,00



Door moulding Lower F R, Scratch(es), Smart repair 110,64




Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Wing F R, Dent(s), PDR - Paintless dent repair 63,00

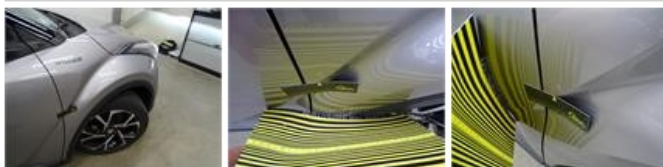

Bumper R, Crack, Le - Replace and paint 651,00

