



**BMW X5: 1NAF304**

Vinnumber:	<b>WBAKT410100K97797</b>	Versionname:	<b>2.0 SDRIVE25D (155KW) AUTO</b>
First Registrationdate:	<b>4/01/2016</b>	Fiscalpower:	
Expertise Mileage:	<b>125652</b>	Power Kw:	<b>155</b>
Bodytype:		Body color:	<b>Grey</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>4 Weel</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>2500</b>	Parking lot:	<b>3625</b>
Maintenance:	<b>OK</b>		
Maintenance:	<b>AUGUSTUS 2020</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>7</b>		
Number head rests:	<b>7</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>No Tow bar</b>
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**






Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>255/55/18/109 H LightMetal</b>				
Winter tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**

	<b>Runflat</b>	<b>Yes</b>
Total cost ex VAT		<b>1895,25</b>
Trunk lid covering R, Scratch(es), Acceptable		<b>0,00</b>
<i>No pictures to display</i>		
Rear wiper blade, Damaged, E - Replace		<b>31,08</b>

<i>No pictures to display</i>		
Seat F L compl, Worn, Acceptable		0,00
<i>No pictures to display</i>		
Tires, Not original part, Acceptable		0,00
<i>No pictures to display</i>		
Door panel F L, Tear, E - Replace		132,00
		
Door F R, Dent(s) and scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Door frame R L, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Wing R L, Dent(s) and scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Boot carpet, Dirty, Cleaning		25,00
		
Door R L, Dent(s) and scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Door panel R L, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Boot carpet, Damaged, E - Replace		120,00
		
Bonnet, Chemical polution, LI - Repair and paint (complete)		348,09
		
Bumper F, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Tailgate, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Door frame R R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Mirror side blinker R, Broken, E - Replace		31,20
		
Shutter / cover, Broken, E - Replace		147,92



Door F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display


Ignition key, Worn, Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 302,16



Roof, Chemical polution, LI - Repair and paint (complete) 625,80

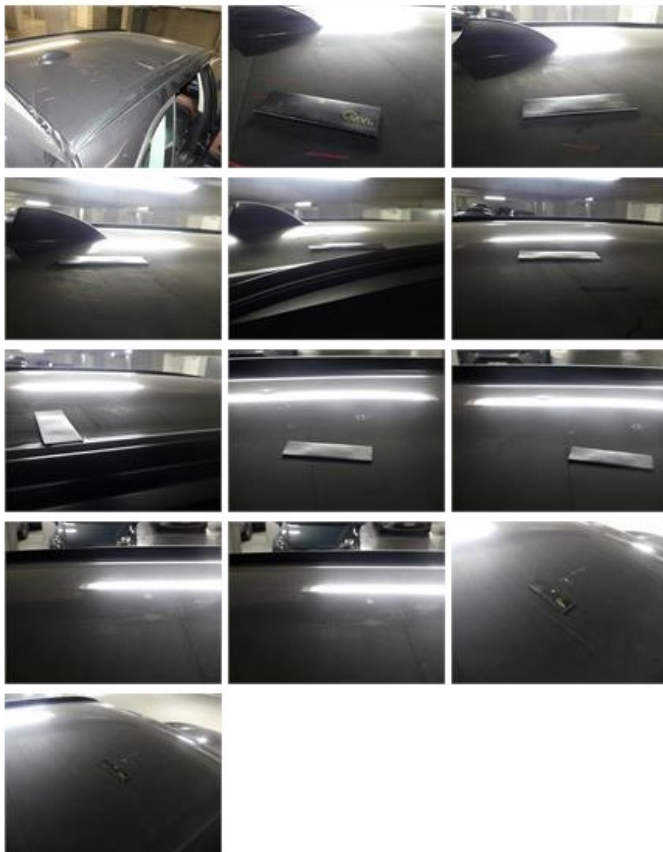

Door panel R R, Tear, E - Replace 132,00



Door R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display