


FORD FOCUS: 1PGX545

Vinnumber:	WF05XXGCC5GK13638	Versionname:	1.0I ECOBOOST 74KW S/S 99G BUSINESS CL
First Registrationdate:	1/07/2016	Fiscalpower:	
Expertise Mileage:	78996	Power Kw:	74
Bodytype:		Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1532
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H Steel			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2114,83
Wheel cover F R, Scratch(es), E - Replace	30,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Dent(s), PDR - Paintless dent repair 63,00




Luggage space cover, Damaged, E - Replace 240,00



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50

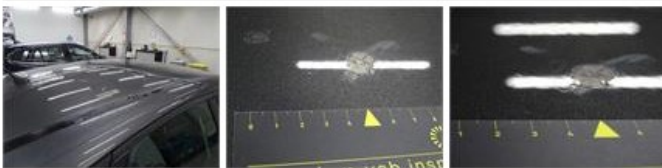

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20




Gear shift lever knob, Worn, Acceptable 0,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Roof pillar R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

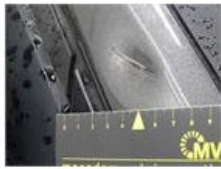

Wheel cover F L, Missing, E - Replace

30,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing F L, Dent(s), Acceptable

0,00

No pictures to display