



BMW 3: 1GIG463

Vinnumber:	WBA3K11090F858816	Versionname:	3 TOURING 318dA 136PK Aut.
First Registrationdate:	14/02/2014	Fiscalpower:	
Expertise Mileage:	197708	Power Kw:	100
Bodytype:		Body color:	Brown
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2404
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 V LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

	Runflat	Yes
Total cost ex VAT		2350,55
Bumper F, Scratch(es), LI - Repair and paint (complete)		254,16



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16



Door F R, Dent(s) and scratch(es), Le - Replace and paint

1270,21



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00





Seat cover F L, Worn, Acceptable

0,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02

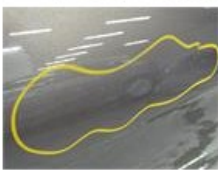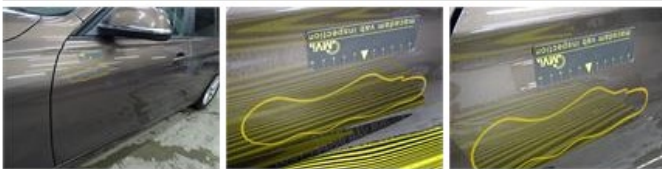

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Dent(s) and scratch(es), Le - Replace and paint

0,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00

