



BMW 3 BERLINE: 1NDZ675

Vinnumber:	WBA8F91030K440302	Versionname:	2.0 316D (85KW) BERLINE
First Registrationdate:	2/02/2016	Fiscalpower:	
Expertise Mileage:	109086	Power Kw:	85
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4728
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Rear parking sensors	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Vredestein: 4 mm	Fr.R.	Vredestein: 4 mm
	Re.L.	Vredestein: 4 mm	Re.R.	Vredestein: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	741,95
-------------------	---------------


Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)	211,80
---	---------------



Alloy rim R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Repaired, Acceptable	0,00



Tailgate, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Roof pillar L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Bad repair, LI - Repair and paint (complete)	318,35

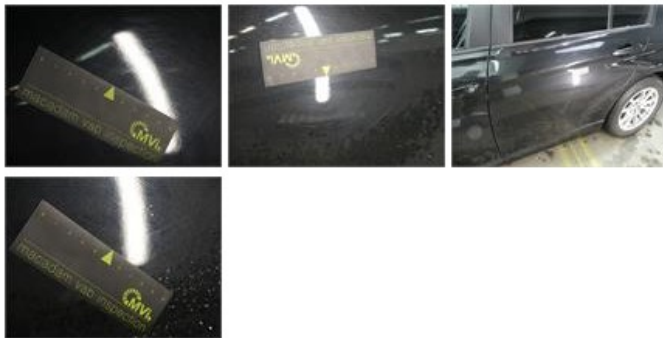

Bonnet, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	211,80



Outer door handle F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	