



MERCEDES C: 1GWJ329

Vinnumber:	WDD2050041F030520	Versionname:	C BER 220 BlueTEC 163PK
First Registrationdate:	19/05/2014	Fiscalpower:	
Expertise Mileage:	180541	Power Kw:	120
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3825
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Seats electric F L
Windows electric F	Seats electric F R
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Radio multimedia	
Type of headlighting	Headlighting LED
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


225/50/17/98 H LightMetal				
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 3786,30

Wing F L, Dent(s) and scratch(es), Le - Replace and paint 530,02

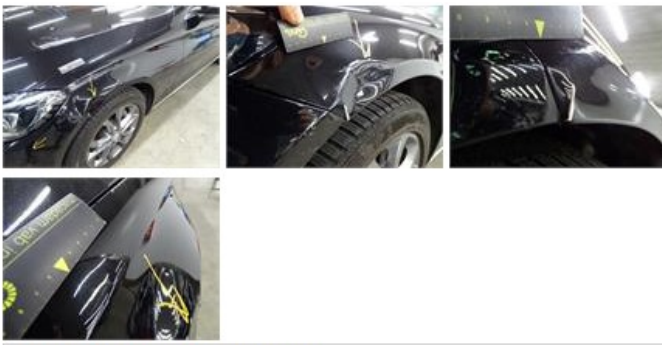

Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Sill trim R, Scratch(es), E - Replace 44,20



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80




Bumper R, Dent(s) and scratch(es), Le - Replace and paint 651,00



Wing R R, Scratch(es), Acceptable 0,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

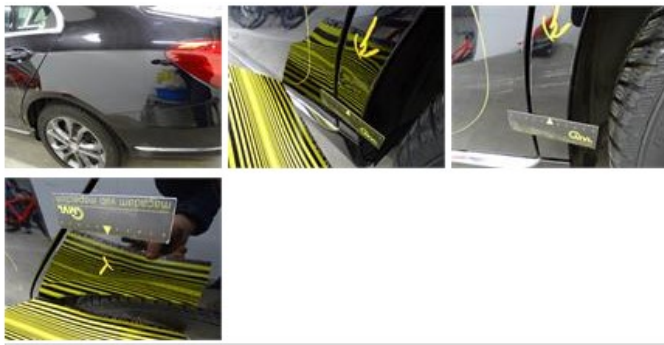

Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Sill trim R, Dent(s) and scratch(es), E - Replace 221,94




Windscreen, Stone chip(s), E - Replace 0,00



Door F R, Dent(s) and scratch(es), Le - Replace and paint 1082,52




Bonnet, Scratch(es), LI - Repair and paint (complete) 290,08

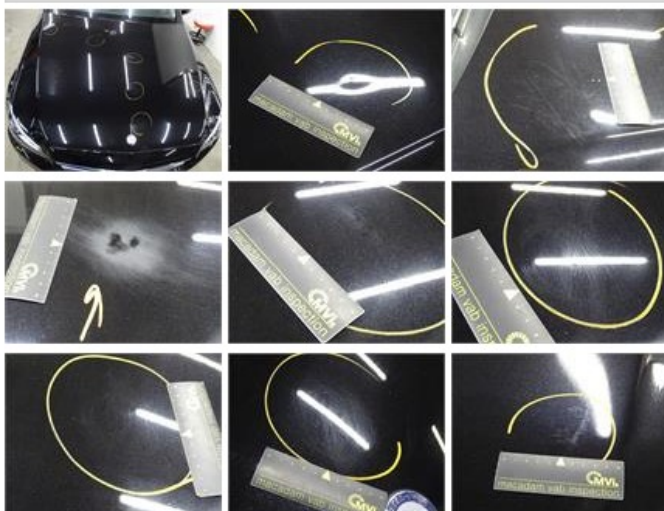

Console storage compartment, Unclashed, Repair/replace (lump sum) 32,19



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 414,35

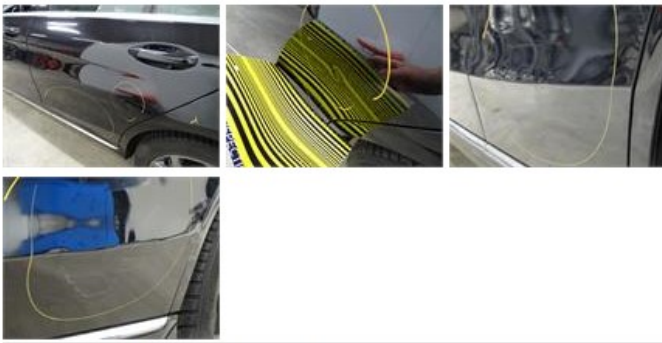

Seat cover R, Scratch(es), Acceptable 0,00

