



FORD Transit 350L: 1EPJ669

Vinnumber:	WF0FXXTTFCT10476	Versionname:	TRANSIT 350EL CH1C LWB RWD DPF(EU5)155PK
First Registrationdate:	14/02/2013	Fiscalpower:	
Expertise Mileage:	28494	Power Kw:	114
Bodytype:		Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Back	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV11
Number of doors:	2		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD		Type of Tow bar	No Tow bar
Windows electric F			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	No climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/75/16/105 R Steel				
Summer tyres:	Fr.L.	Semperit: 4 mm	Fr.R.	Semperit: 4 mm
	Re.L.	Semperit: 4 mm	Re.R.	Semperit: 4 mm

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT 3182,89

Wing R R, Dent(s) and scratch(es), Acceptable 0,00


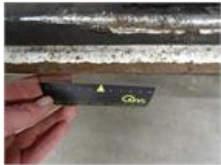


















No pictures to display

Tailgate, Dent(s) and scratch(es), Le - Replace and paint 433,50



Sill outer L - Rust. LI - Repair and paint (complete)

232,88

		
Bumper F, Broken, E - Replace		398,40
		
Dashboard, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Sidewall mid L (LCV) , Rust, Acceptable		0,00
<i>No pictures to display</i>		
Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)		165,13
		
Bonnet, Dent(s), PDR - Paintless dent repair		63,00
		
Floor covering F L, Damaged, E - Replace		237,00
		
Wheel cover F R, Missing, E - Replace		22,50
		
Seat F R compl, Damaged, E - Replace		480,00
		
Door seal F R, Deformed / Strained, E - Replace		46,50
		
Door seal F L, Deformed / Strained, E - Replace		46,50
		
Sill outer R, Rust, LI - Repair and paint (complete)		232,88



Rearview mirror glass L, Missing, E - Replace 13,50



Sill trim F R, Broken, E - Replace 71,60



Seat F L compl, Damaged, E - Replace 480,00



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F L, Missing, E - Replace 22,50



Floor covering F R, Damaged, E - Replace 237,00

