



MERCEDES A: 1PRV117

Vinnumber:	WDD1760121J511706	Versionname:	A 180 d BlueEFFICIENCY Edition
First Registrationdate:	1/09/2016	Fiscalpower:	
Expertise Mileage:	105666	Power Kw:	80
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1733
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Type of Tow bar	No Tow bar
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/95 V Steel			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1330,84
Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80



Roof, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 370,00



Wheel cover F L, Scratch(es), E - Replace 30,00




Wheel cover R L, Scratch(es), E - Replace 30,00



Wheel cover F R, Missing, E - Replace 30,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80

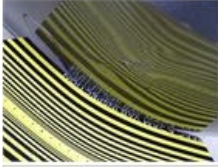

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Wheel cover R R, Broken, E - Replace 30,00



Sill outer R, Dent(s) and scratch(es), It - Spot repair 115,56

