



CITROEN GRAND C4 PICASSO: DM6483

Vinnumber:	VF73ABHXMfJ796088	Versionname:	1.6 BLUEHDI 115 S/S MAN6 BUSINESS GPS
First Registrationdate:	28/10/2015	Fiscalpower:	
Expertise Mileage:	153352	Power Kw:	85
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2202
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	No		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2085,79
Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35



Door R R, Dent(s), Acceptable 0,00

No pictures to display Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display Tailgate, Dent(s), Acceptable 0,00

No pictures to display Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display Door F L, Scratch(es), Acceptable 0,00

No pictures to display Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door F R, Scratch(es), Acceptable 0,00

No pictures to display Trunk lid covering R, Scratch(es), Smart repair 110,64




Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Bonnet, Hail damage, PDR - Hail 300,00



Roof, Hail damage, PDR - Hail 625,00

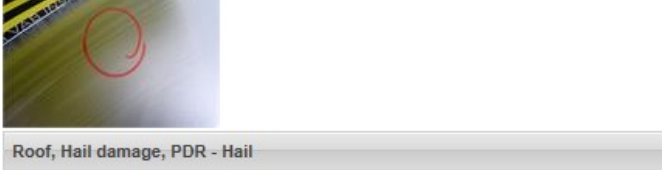

Roof, Hail damage, PDR - Hail 625,00

