



VOLVO V40: 1NDA243

Vinnumber:	VV1MV7431G2326854	Versionname:	2.0 D2-82 KINETIC
First Registrationdate:	25/01/2016	Fiscalpower:	
Expertise Mileage:	157326	Power Kw:	88
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2711
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Bridgestone: 7 mm	Fr.R.	Bridgestone: 7 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2230,45
Headlight R, Scratch(es), E - Replace	396,00



Alloy rim FR, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Tyre RR, Tear, E - Replace 132,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door RR, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bodywork, Not original part, Acceptable 0,00

No pictures to display

Bumper grille FR, Missing, E - Replace 49,00




Alloy rim RL, Scratch(es), LI - Repair and paint (complete) 95,00




Bonnet, Chemical polution, Acceptable 0,00

No pictures to display

Roof, Scratch(es), LI - Repair and paint (complete) 481,50

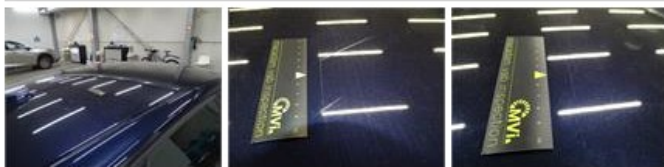

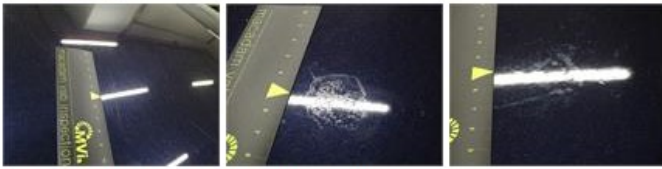

Wing RR, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Alloy rim RR, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim FL, Scratch(es), LI - Repair and paint (complete) 95,00



Interior, Stain, Cleaning 50,00

